

Finlux 71E50
Salora 28SE50
Luxor 70SQ10

On the market 2001...

Stereo E9-chassies

Dated	Chassis	Faults appeared in the colours	Possible cause of the fault
			*
		Faults appeared in the picture	
15.10.01	E9	Poor colour purity, color spots on the screen	* Check demagnetization coil. There maybe a shortcircuit in the connection point, where the out coming cable and coil winding wires are joined together (under tape) The resistance of proper coil is appr. 25R, in fault case the resistance is about 1R...2R
		Faults appeared in the sound	
04.01.02	E9	Nicam sound crackles (after warm-up)	* Check stamping on crystal Q521 (sound module). If HCJ-12, remove capacitors c564 and c565. Note! With stamping HCJ-20, right value for c564 and c565 is 12p With stamping HCJ-12, no capacitors at all (or 1.8p)
		No picture	
			*
		Other	
			*