

SALORA 16J10, 22J10, 16J20, 20J20, 22J20, 26J20,
20J40, 22J40, 26J40, 22J50, 26J50, 22J70,
26J70, 26J90

1J-chassis

Chassis	Faults appeared in the colours	Possible cause of the fault
1J	No colours	* RB235, RB238, XTB200, CTB200, DLB200
	Faults appeared in the picture	
1J	Horizontal shift does not work	* RB564
1J	Weak contrast, colour purity error	* RH13, RH14, RH15
16J10	Demagnetization work all the time	* Check 12.5V (coming from socket module), TH1, TH2
16J10	After-glow	* Mount a cascade with bleeder resistor
	Faults appeared in the sound	
1J	After switching off, a quiet whistling	* CB115
	No picture	
1J	No picture, sound ok	* Check sandcastle pulse and measuring automatic. TB400, TB209
16J10	No picture	* Check demagnetization thyristor THH1
	Other	