

MX 4:3, 100Hz  
MZ 16:9, 100Hz

MX made in Turku 1997...2000  
MZ made in Turku 1997...2000

# Multi Concept chassies

Dated	Chassis	Faults appeared in the colours	Possible cause of the fault
			*
		<b>Faults appeared in the picture</b>	
	MX, MZ	Vertical stripe on picture (a bit right from center)	* EMI-shield. Look at Multi Concept Service Info 98-01
03.06.99	MX, MZ	After start up, no luminance, just dark colours	* Look Service Bulletin Multi Concept 99-10
04.06.99	MX, MZ	During TV is on, luminance disappears, just dark colours	* In DB720/730, check possible short circuit between foil R95/C89 and radiation shield. Look Service Bulletin Multi Concept 99-10
14.12.00	MX, MZ	So-called "wool yarn" stripe on right side on VHF I band	* Change capacitor Co13 from 680p (3345 0053) to <b>820p</b> (3345 0039)
		<b>Faults appeared in the sound</b>	
	MX, MZ	3D sound crackles	* Replace car1 (22p) for 24p, add 24p from icar1 pin 8 to ground, Service Bulletin 99-05
		<b>No picture</b>	
	MX, MZ	No picture, if warm TV is switched off and on again	* Change resistor rs6 from 180k (original) to 270k (new). Test series going on 05.08.98
		<b>Other</b>	
	MX	Difficult to start up, picture unstable, U1 too low	* co58 on pin 1 of TEA5170